


## **SMA Jack Crimp**

50Ω

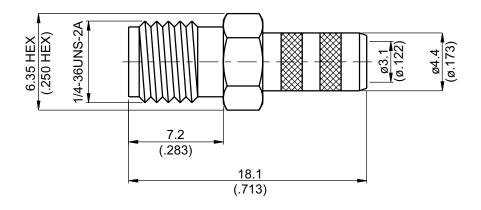

Parts	Material	Plating (Micro-inch)
Ferrule	Brass	Gold 5 Over Nickel 50 Over Copper 50
Contact Pin	Beryllium Copper	Gold 20 Over Nickel 50 Over Copper 50
Insulator	Teflon	
Body	Brass	Gold 5 Over Nickel 50 Over Copper 50

Weight: 2.74 g

Suitable Cables: RG58, JBY195

## **CABLE ASSEMBLY INSTRUCTION** SMA8100-0058 Α С | • | **FERRULE CONTACT PIN BODY** DIAGRAM ASSEMBLY INSTRUCTION Step 1: STRIP AS SHOWN. 4.1 [.161] 2.5 [.098] В Α Step 2: SLIDE FERRULE "A" OVER CABLE. Step 3: PUT PIN "B" ON CENTER CONDUCTOR AND SOLDER IN "Y". С Step 4: LOOSEN BRAIDING AND SLIDE CONNECTOR "C" IN PLACE. С Step 5: SLIDE FERRULE "A" TOWARDS THE CONNECTOR "C" AND CRIMP.